

544
"COMPANY PRIVATE"

FIRST CLASS MAIL

Installation Engineering Handbook 18
Western Electric Company, Incorporated
Kearny Works

T.M. 8.74

11-20-70

TEMPORARY MEMORANDUM

POWER

KS-15912 LISTS 1 AND 10 LIGHTING FIXTURES MANUFACTURED
BY GEECO

1. GENERAL

1.1 Fluorescent Lighting Fixtures per KS-15912 Lists 1 and 10, manufactured by the GEECO Company, St. Joseph, Missouri, have been found to be equipped with defective side panels.

1.2 The defective side panels are insufficiently rigid and tend to warp and distort to the extent that some panels have fallen off the fixtures and caused injury to personnel and equipment. This condition exists on all KS-15912 Lists 1 and 10 Lighting fixtures made by GEECO shipped to the field prior to 11-5-70 which have not been turned over to the telephone company.

1.3 On lighting fixtures turned over to the customer, the telephone company will replace the panels on a maintenance basis.

2. INSTALLING EQUIPMENT

2.1 No tools other than an R-2448 Screwdriver will be required.

3. ADDITIONAL MATERIAL

3.1 Each KS-15912 Lists 1 or 10 Lighting Fixture requires two (2) KS-15912-3X Lexan side panels. These shall be requisitioned by the installer from the functional Service Center.

4. CORRECTIVE ACTION

4.1 The installer shall determine whether the lighting fixtures on his job fall into the category described in Paragraph 1.2. If they do, he shall order the required number of KS-15912-3X Lexan panels as described in Paragraph 3.1.

4.2 When the new panels have been received, the defective side panels shall be removed and the Lexan panels shall be installed. The new panels are so designed that no tools are required to install them. They are equipped with a flange which will snap over the rim of the housing on the lighting fixture.

4.3 The defective side panels shall be disposed of locally.

5. DISPOSITION OF EXPENSE

5.1 If the amount of work involved in performing the above operation is sufficient to meet the requirements of C.I. 47.242, it shall be reported on the SD-1007, J.I.M. for the issuance of a Type X supplementary estimate in the X-34 category.

Manager, Product Engineering

DISTRIBUTION:

- 1 Copy to Field Holders of the Installation Engineering Handbook
- 1 Copy to Regional Engineering Manager
- 3 Copies to Installation Area Managers
- 1 Copy to District Managers
- 1 Copy to Area Supervisors
- 1 Copy to Department Chiefs, Technical Coordination
- 1 Copy to Department Chiefs, Regional Installation Engineering
- 10 Copies to Regional Assistant Manager, Scheduling and Service
- 1 Copy to Department Chiefs, Regional Quality Service Management
- 2 Copies to Department Chief, Complaints Engineering, 222 Broadway